

# Manhole Inspection Summary

Manhole # S27I\_\_019MH

Printed On: 3/13/2009

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **271** Node: **019** Status: **Found**

Insp Date: **1/21/09 12:53 PM**

Incomplete Comments

Crew: **WJ/DH**  
Inspector: **dhinton**  
Firm: **PER**

**Location** Address: **1000 S.Schroeder St.**

Cross Street: **W.Lombard St.**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)  
**5**

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **1.5** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **5** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present


# Manhole Inspection Summary

Manhole # S27I\_\_019MH

Printed On: 3/13/2009

Page 2 of 5

Location View

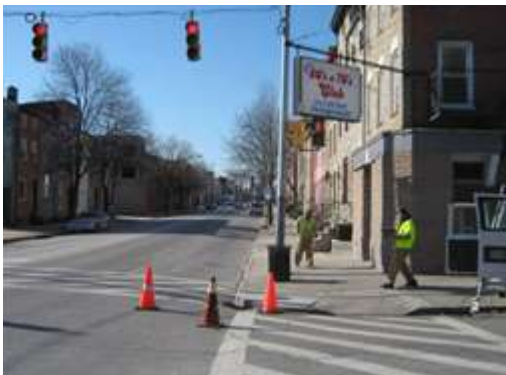

Top View



Miscellaneous



MH Lid

Defect 6



chimney deteriorated with infiltration at mortar & joint

Defect 5



corroded rungs with chimney and corbel infiltration at walls

Defect 1



debris on bench

### Defect 3



frame offset 1.5 inches

## Manhole Inspection Summary

Manhole # S27I\_\_019MH

Printed On: 3/13/2009

Page 4 of 5

12 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **3.6** (in.) Direct (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.80** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 2 O'Clock

2 O'Clock Inflow



connection is under mh shelf and cannot be  
see from top view

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.70** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S27I\_\_019MH

Printed On: 3/13/2009

Page 5 of 5

12 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



Pipe Height: **12** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.66** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.62** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection